

2001 3.2TL - Glove Box Removal/Installation


SRS components are located in this area. Review the SRS component locations, and the precautions and procedures in the SRS section before performing repairs or service.

NOTE: Take care not to scratch the dashboard and related parts.

1. Remove the screw, then remove the damper (A) from the glove box.
2. While holding the glove box, remove the glove box stop (C) on each side.

Fastener Location


► : Screw, 1

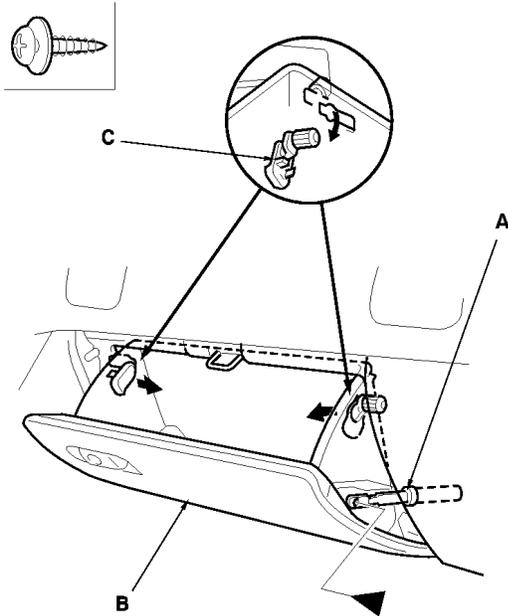

3. Remove the screws, then remove the glove box.

Fastener Locations


► : Screw, 2

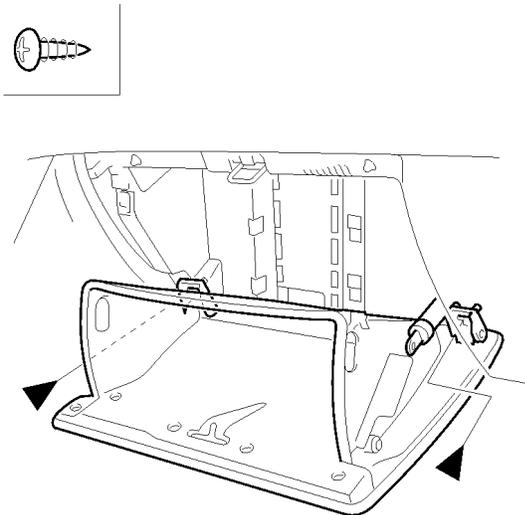

4. Remove the passenger's front console cover.
5. Detach the clips, and release the hook (A), then remove the right dashboard side cover (B).

Fastener Locations


▷ : Clip, 3

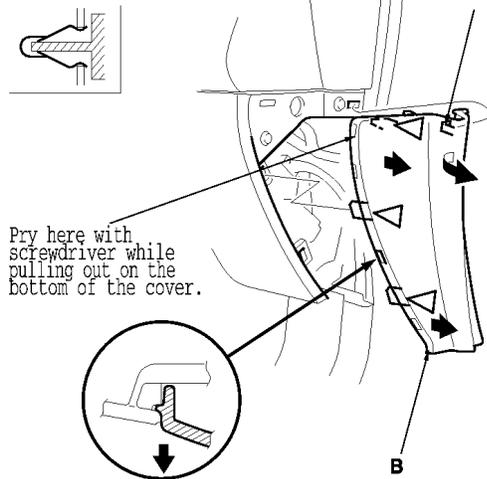


6. Remove the screws (A and B), and detach the clips (C and D). Disconnect the trunk lid opener main switch connector (E) and glove box light bulb socket (F), then remove the glove box cover (G).
7. Install the glove box in the reverse order of removal, and make sure the trunk lid opener main switch connector and glove box light bulb socket are plugged in properly.

Fastener Locations

A ▶ : Screw, 3 B ▶ : Screw, 2 C ▷ : Clip, 3

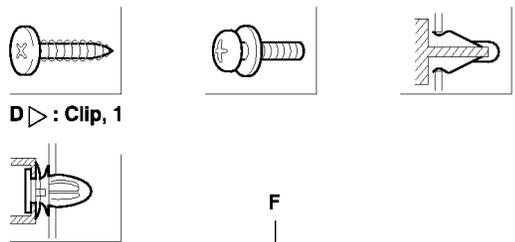

D ▷ : Clip, 1

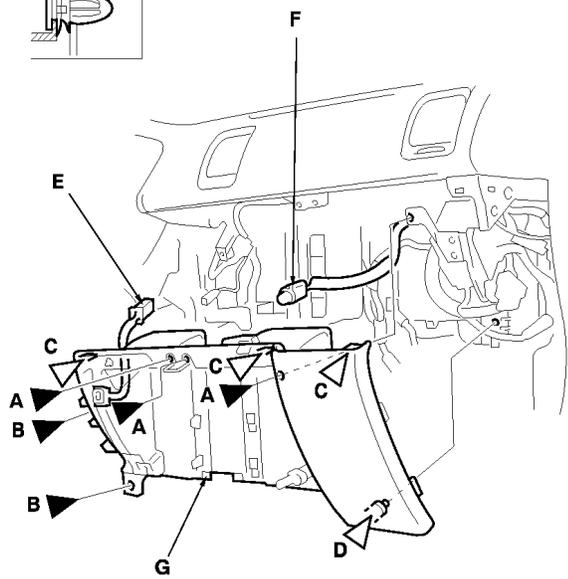



Applies To: 1999-03 3.2 TL – ALL
2001-03 3.2 CL – ALL

April 27, 2006

Blower Motor Does Not Work

(Supersedes 06-006, dated February 14, 2006 to update the information with the black bars)

SYMPTOM

The blower motor does not work at all.

PROBABLE CAUSE

Poor connection at the blower motor caused by tension on the wiring harness.

CORRECTIVE ACTION

Install a blower motor subharness.

PARTS INFORMATION

Blower Motor Subharness: P/N 04321-S0K-A00

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 6181A4

Flat Rate Time: 0.6 hour

Failed Part: P/N 32150-S0K-A04

Defect Code: 06401

Symptom Code: 01201

Template ID: 06-006A

Skill Level: Repair Technician


Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE


1. Remove the glove box and cover:
 - 1999-03 3.2 TL: See page 20-66 of the 1999-03 3.2 TL Service Manual.
 - 2001-03 3.2 CL: See page 20-64 of the 2001-03 3.2 CL Service Manual.
 - Online, enter keyword **GLOVE**, and select **Glove Box Removal/Installation** from the list.

2. Disconnect the brown 7P connector (C202) from the main harness. Remove the YEL/BLK wire terminal from cavity 3 of connector C202. Cut off the terminal, and tape the remaining end of the wire to the harness.

NOTE: If necessary, refer to the terminal replacement section of the appropriate ETM for how to properly remove a terminal from a connector.

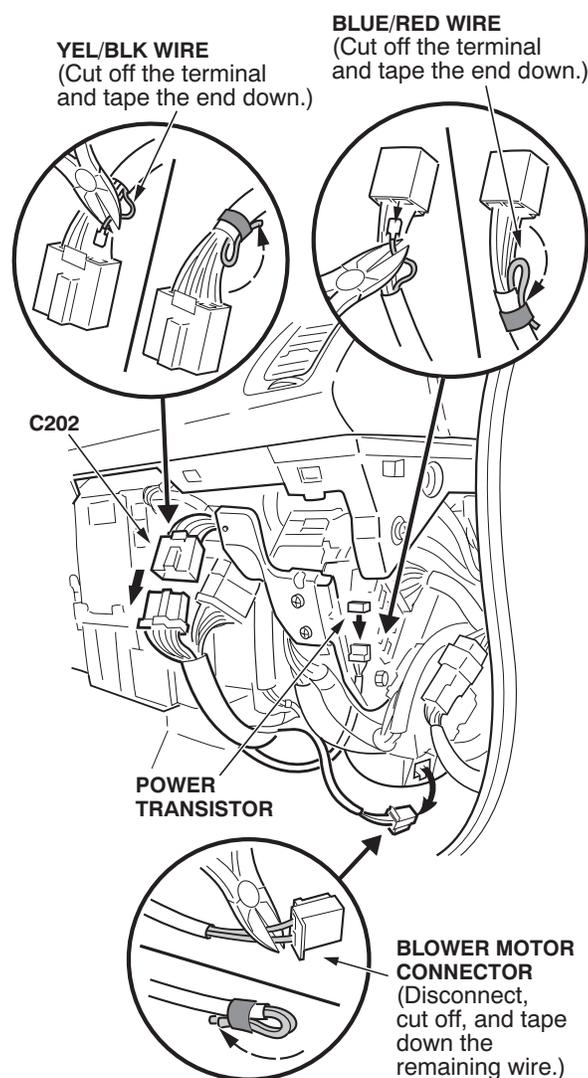

3. Disconnect the 2P blower motor connector, cut off the connector, and tape the remaining ends of the wires to the pigtail. Then tape the pigtail to the main harness.
4. Disconnect the white 5P connector from the power transistor. Remove the BLU/RED wire terminal from cavity 4 of the power transistor connector. Cut off the terminal, and tape the remaining end of the wire to the harness.
5. Take the subharness, and insert the YEL/BLK wire terminal into cavity 3 of connector C202 and insert the BLU/RED wire terminal into cavity 4 of the power transistor connector. Tape both wires to the existing harness. Route the harness so there is no tension on the blower motor connector.

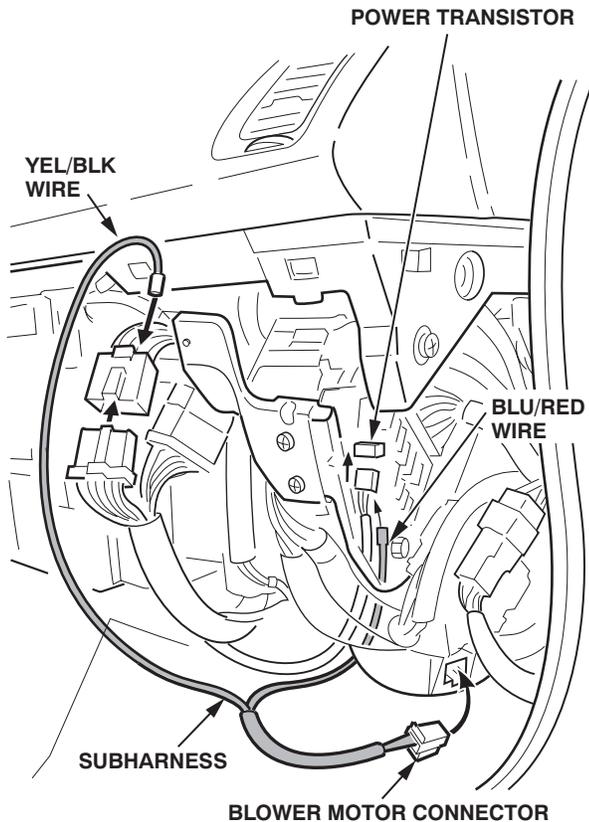

6. Reconnect connector C202 and the power transistor connector, then connect the 2P connector on the new subharness to the blower motor.
7. Verify the blower motor operates properly at all speeds.
8. Reinstall the glove box and cover.