



## MIL Comes On With DTC P1149

### SYMPTOM

The MIL is on, and DTC P1149 (air/fuel ratio sensor range/performance problem) is set.

### PROBABLE CAUSE

Under certain driving conditions, the ECM/PCM sets a false DTC P1149.

### CORRECTIVE ACTION

Replace the ECM/PCM.

### PARTS INFORMATION

1998-99 (All): P/N 37820-PAA-305, H/C 6695720

2000 (A/T): P/N 37820-PAA-306, H/C 6695738

2000 (M/T): P/N 37820-PAA-307, H/C 6695746

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

OP #	Description	FRT	Template ID
123503	Retrieve the DTC. <b>Write the DTC in the ECU field of the warranty claim form.</b>	0.3	
121100	Replace the ECM/PCM. <b>Choose a template ID based on the replacement P/N.</b>	0.4	
	P/N 37820-PAA-305		01-031A
	P/N 37820-PAA-306		01-031B
	P/N 37820-PAA-307		01-031C

Failed Part: P/N 37820-PAA-L80  
H/C 6286421

Defect Code: 072

Contention Code: C99

Skill Level: Repair Technician

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

### DIAGNOSIS

Connect the PGM Tester to the vehicle's DLC (data link connector), and check for DTCs.

- If DTC P1149 is stored, go to REPAIR PROCEDURE.
- If another DTC is stored, go to the appropriate troubleshooting procedure in the service manual.

### REPAIR PROCEDURE

Replace the ECM/PCM with the appropriate part listed under PARTS INFORMATION. For replacement information, see *How to Remove the ECM/PCM for Testing* on page 11-4 of the 1998-01 Accord Service Manual.