

[Home](#) | [Account](#) | [Contact ALLDATA](#) | [Log Out](#) | [Help](#)

PAUL REDEHOFT

[Select Vehicle](#) | [New TSBs](#) | [Technician's Reference](#) Component Search: 

OK

Conversion Calculator

**1992 Mazda MX-5 Miata L4-1597cc 1.6L DOHC**[Vehicle Level](#) → [Windows and Glass](#) → [Window Regulator](#) → [Technical Service Bulletins](#) → [All Technical Service Bulletins](#) → [Window Regulator - Hard To Operate](#) ←**Window Regulator - Hard To Operate**[Notes](#)

Bulletin No.: 038/93

Issued: 9/3/93

Revised:

CategoryS

Applicable Model/s

1990 - 93 MX-5 MIATA

Subject:

DIFFICULT OPERATION OF THE WINDOW REGULATOR

**APPLICABLE MODELS/VINS**

MX-5 MIATA

1990 - Vehicles with a VIN of JM1NA351\*L0100001 through JM1NA351\*L0199999

1991 - Vehicles with a VIN of JM1NA351\*M0200001 through JM1NA351\*M0299999

1992 - Vehicles with a VIN of JM1NA351\*N0300001 through JM1NA351\*N0399999

1993 - Vehicles with a VIN of JM1NA351\*P0400001 through JM1NA351\*P0418882

**NOTE** : The asterisk (\*) can be any number (0 through 9) or "X".**DESCRIPTION**


Vehicles with hard to operate window regulators may have twisted glass guides. The glass guide may have been twisted during assembly which causes the window to bind during operation. To prevent this condition, a spacer has been placed in the door body which prevents the glass guide from twisting.

**NOTE** : Replacing the window regulator will not correct this problem.**REPAIR PROCEDURE**

1. Remove the door trim and loosen the upper and lower glass guide installation nuts.

2. Pull the glass guide toward the inner door panel and slightly tighten the lower glass guide installation nut.

**NOTE :** There should be no twist in the glass guide after tightening the lower installation nut.

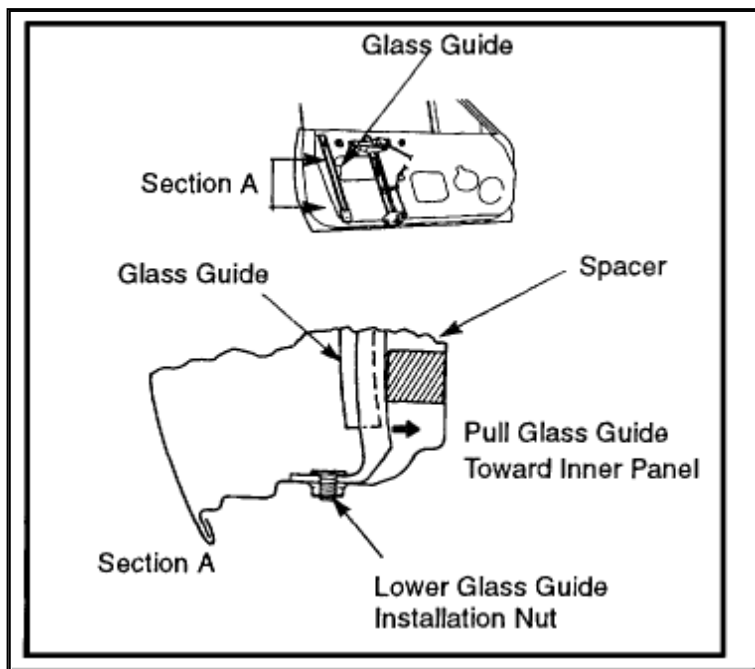

Zoom

Sized for Print

3. Insert a spacer (approx. 33 - 35 mm wide) between the door panel and the glass guide as shown in the illustration.
4. Tighten the lower glass guide installation nut pulling the nut toward the inner door panel.
5. Remove the spacer, test window and if necessary, adjust the glass guide.

Warranty Type:	A
Symptom Code:	64
Damage Code:	9H
Part Number Main Cause:	NA01 58 603A
Quantity:	0
Operation Number:	S1004XRX
Labor Hours:	0.6 Hrs.

Zoom

Sized for Print

**WARRANTY INFORMATION**  
(Applies to vehicles covered under normal warranty.)

© 2010 ALLDATA LLC. All rights reserved.  
[Terms of Use](#)