

[Select Vehicle](#) | [New TSBs](#) | [Technician's Reference](#)Component Search:  [Conversion Calculator](#)**2003 Mercedes Benz CLK 320 (209.365) V6-3.2L (112.955)**[Vehicle Level](#) → [Restraint Systems](#) → [Seat Belt Systems](#) → [Seat Belt Retractor](#) → [Technical Service Bulletins](#) → [All Technical Service Bulletins](#) → [Restraints - Rear Seat Belt Won't Retract Properly](#) ←

## Restraints - Rear Seat Belt Won't Retract Properly

[Notes](#)

Date: October 11, 2006  
Order No.: P-B-91.40/130  
Supersedes:  
Group: 91

SUBJECT:  
All Model 171, 203, 209, 211, 219, 220, 221 and 230

[Seat Belt](#) Does Not Roll Up Correctly

If you receive customer reports in the above model vehicles of the front or rear [seat belts](#) not rolling up fully, the cause could be dirt deposits on the seat belt guide due to a soiled seat belt. Cleaning the belt guide and seat belt should restore proper function of the seat belt retraction. To resolve, perform the following.



Figure 1

P-B-91.40/130

Zoom

Sized for Print

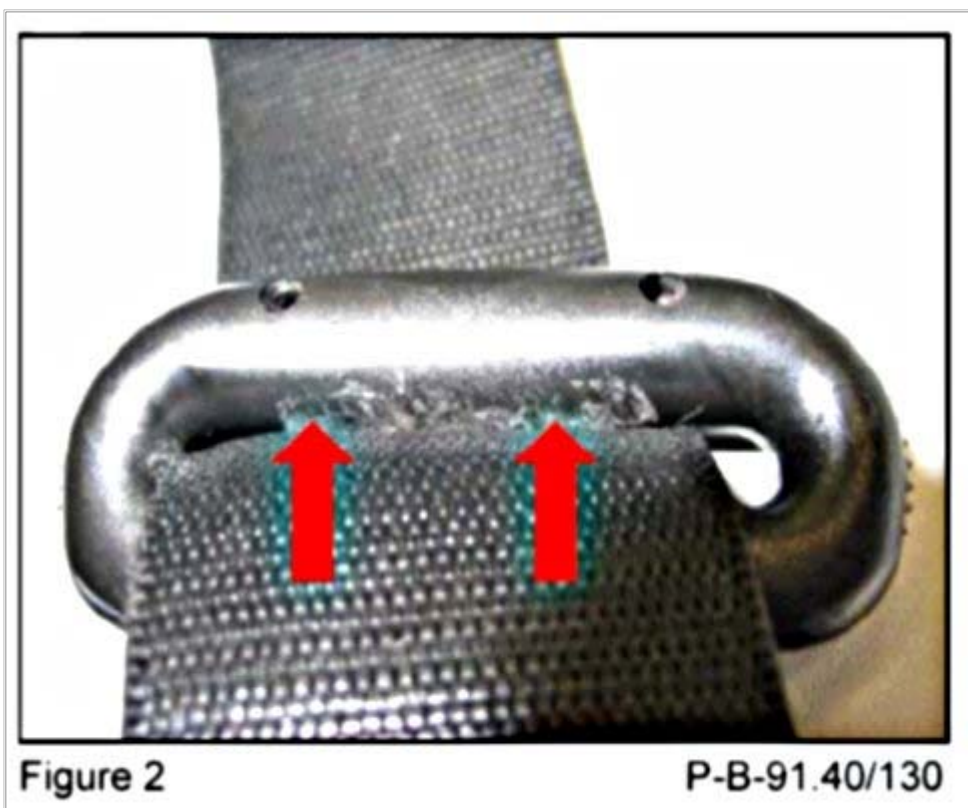


Figure 2

P-B-91.40/130

Zoom

Sized for Print

1. Clean the belt guide using MB Interior Care (Figures 1 and 2).
2. Clean the [seat belts](#) using MB Car Shampoo mixed with water, MB Textile Carpet/Fabric Care or clean, lukewarm water and soap. Do not treat the belt with any other cleaning agents.
3. Extend belt and allow to air dry. Do not dry at temperatures above 175 degrees F (80 degrees C) or in direct sunlight. Do not bleach or dye.

**NOTE:** If these instructions are not followed, proper retraction of the [seat belt](#) may be impaired.

**NOTE:** This repair cannot be claimed under warranty.

Qty.	Part Name	Part Number
1	MB Interior Care	BQ6 98 00 16
1	MB Car Shampoo	BQ6 98 00 12
1	MB Textile Carpet/Fabric Care	BQ6 98 00 19

Zoom

Sized for Print

## Parts Information

© 2008 ALldata LLC. All rights reserved.

[Terms of Use](#)

[Select Vehicle](#) | [New TSBs](#) | [Technician's Reference](#)Component Search:   [Conversion Calculator](#)**2003 Mercedes Benz CLK 320 (209.365) V6-3.2L (112.955)**[Vehicle Level](#) → [Restraint Systems](#) → [Seat Belt Systems](#) → [Seat Belt Retractor](#) → [Technical Service Bulletins](#) → [All Technical Service Bulletins](#) → [Restraints - Seat Belt Won't Retract Completely](#) ←

## Restraints - Seat Belt Won't Retract Completely

[Notes](#)

Date: February 27, 2006

Order No.: P-B-91.40/100

Supersedes:

Group: 91

SUBJECT:

Model 209.356/365/375/376/456/465/475/476

[Seat Belt](#) Not Retracting Completely

If you receive customer reports in the above model vehicle of the [seat belt](#) not retracting completely, perform the following procedure to secure the seat belt guide. The seat belt guide may have become detached from the inertia reel.


Inspection:



Figure 1

P-B-91.40/100

1. Carefully pull the seat belt extender (Figure 1, 1) out and unclip the cover frame (Figure 1, 2).

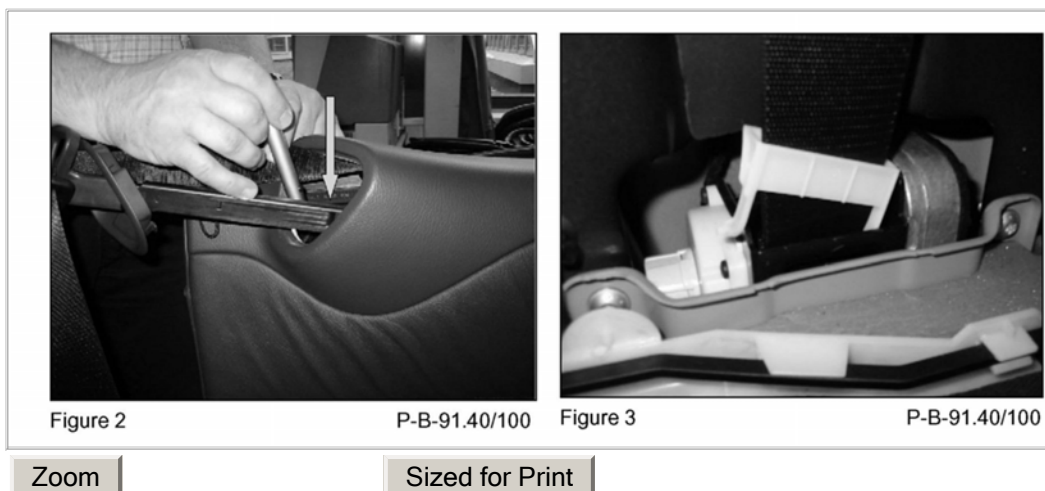


2. Pull the [seat belt](#) out completely and using a flashlight check to see if the seat belt guide has become detached (Figure 2 and 3).

Repair:

1. Gain access to the inertia reel; refer to WIS document AR68.30-P-4780Q (coupe) or AR68.30-P-4780QA (cabriolet).

**Note** : The inertia reel does not need to be removed

2. Reinstall white plastic [seat belt](#) guide back into position.

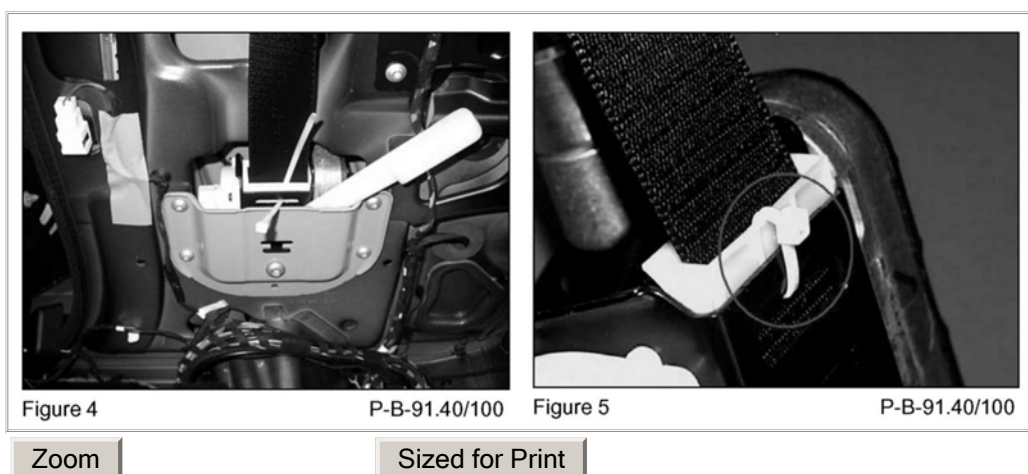

3. Use a wedge tool to push the inertia reel slightly away from the tan mounting bracket. Bend the cable tie and thread it through the [seat belt](#) guide and the black part of the inertial reel bracket (Figure 4).

Qty.	Part Name	Part Number
1	Cable tie	N000000 000667 **

**\*\*Parts are in a critical supply situation and will be limited, please see the PAC weekly status report on parts availability status and delivery expectations. This report is located on the PAC website.**

Zoom

Sized for Print

- Secure the cable tie so that the buckle of the cable tie faces away from the [seat belt](#). The cable tie must not be able to move where it will contact the seat belt (Figure 5).
- Reassemble in reverse order.

Qty.	Part Name	Part Number
1	Cable tie	N000000 000667 **

**\*\*Parts are in a critical supply situation and will be limited, please see the PAC weekly status report on parts availability status and delivery expectations. This report is located on the PAC website.**

Zoom

Sized for Print

## Parts Information

**Note :** The following allowable labor operations should be used when submitting a warranty claim for this repair

<b>Operation:</b>	Seat belt guide, check (91-0000)		
	Interior trim panel - left rear upper, R&R (68-1182)		
	Interior trim panel - right rear upper, R&R (68-1185)		
	Interior side panel - at one rear quarter window, R&R (68-1180)		
	Interior side panel - at both rear quarter windows, R&R (68-1187)		
Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
91A52 52 (left)	91 0000	0.1 hrs.	S1, S2, S3, S4, S5, S6, S7, S8
91N52 52 (right)			
Coupe	If necessary		
	68 1182	0.5 hrs.	S1, S2, S3, S7
	If necessary		
	68 1185	0.5 hrs.	S1, S2, S3, S7
Cabriolet	If necessary		
	68 1180	1.3 hrs.	S4, S5, S6, S8
	If necessary		
	68 1187	1.7 hrs.	S4, S5, S6, S8

Zoom

Sized for Print

## In Case of Warranty

[Terms of Use](#)