

5.4L 3V / 4R75E ONLY—BUILT BETWEEN 12/4/2006 TO 5/20/2008—ENGINE RPM FLARE DURING 3-4 UPSHIFT UNDER LIGHT THROTTLE ONLY

TSB 08-14-3

FORD:
2007-2008 F-150

LINCOLN:
2007-2008 Mark LT

This article supersedes TSB **08-8-11** to add a production fix date.

ISSUE

Some 2007-2008 F-150 and Mark LT vehicles built between 12/4/2006 to 5/20/2008 and equipped with a 5.4L 3V and 4R75E, may exhibit an engine RPM flare during light acceleration during the 3-4 upshift. This would only occur at road speed ranges from 25-30 MPH (40-48 Km/h). No DTCs or other drivability or transmission issues would be present.

ACTION

Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 54.5 and higher. This new calibration is not included in the VCM 2008.3 DVD. Calibration files may also be obtained at www.motorcraft.com.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage
IMPORTANT: Warranty coverage limits/policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

OPERATION	DESCRIPTION	TIME
081403A	2007-2008 F-150, Mark LT 5.4L 3V, 4R75E: Check DTCs Reprogram The PCM Authorization Decal Not Required. Time Includes road Test (Do Not Use With 12650D)	0.6 Hr.
DEALER CODING		
BASIC PART NO.		CONDITION CODE
RECAL		04

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.