


**1992 Acura Legend Sedan V6-3206cc 3.2L SOHC FI**

[Vehicle Level](#) → [Accessories and Optional Equipment](#) → [Radio/Stereo](#) → [Service and Repair](#) ⇄

**Service and Repair**

[Notes](#)

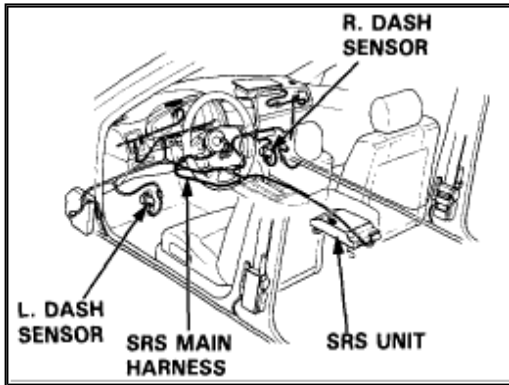

Zoom

Sized for Print

SRS wire harnesses are routed near the steering column and passenger's side dashboard.

**CAUTION:**

- All SRS wiring harnesses are covered with yellow outer insulation.
- Before disconnecting any part of the SRS wire harness, install the short connectors.
- Replace the entire affected SRS harness assembly if it has an open circuit or damaged wiring.

**STEREO RADIO/CASSETTE REPLACEMENT**

**NOTE** (L and LS models): These versions have a stereo radio/cassette player with a 5-digit coded theft protection circuit. Be sure to get the code number before: -disconnecting the battery.

- removing the No. 56 (7.5 A) fuse.
- removing the radio.


After reconnecting power and turning the radio ON, the word "CODE" will be displayed. Then enter the code.

1. Remove the center console panel.

2. Remove the 2 mounting bolts, then disconnect the ground cable. Remove the stereo radio/cassette by pulling it Out of the console. **NOTE:**

- Do not drop the bolts inside the dashboard.
- Take care not to scratch the console and dashboard.
- When prying with a flat tip screwdriver, wrap it with protective tape to prevent damage.

3. Disconnect the connectors.

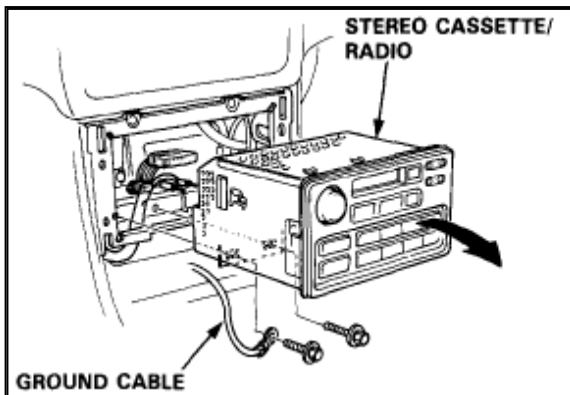

Zoom

Sized for Print

4. Installation is the reverse of the removal procedure. **NOTE:** Before tightening the mounting bolts, make sure the harnesses are not pinched.